


Smoke and Dye Testing Summary

High Level Sewershed

Run Summary

Test ID	Test Type	Date Inspected	Company / Super.	Blower MH	Ground Condition	Notification Made?	Total Length
S1028-186	Smoke	7/21/2009	ADS/TM	S15AA_015MH	Dry	Yes	1,136.67

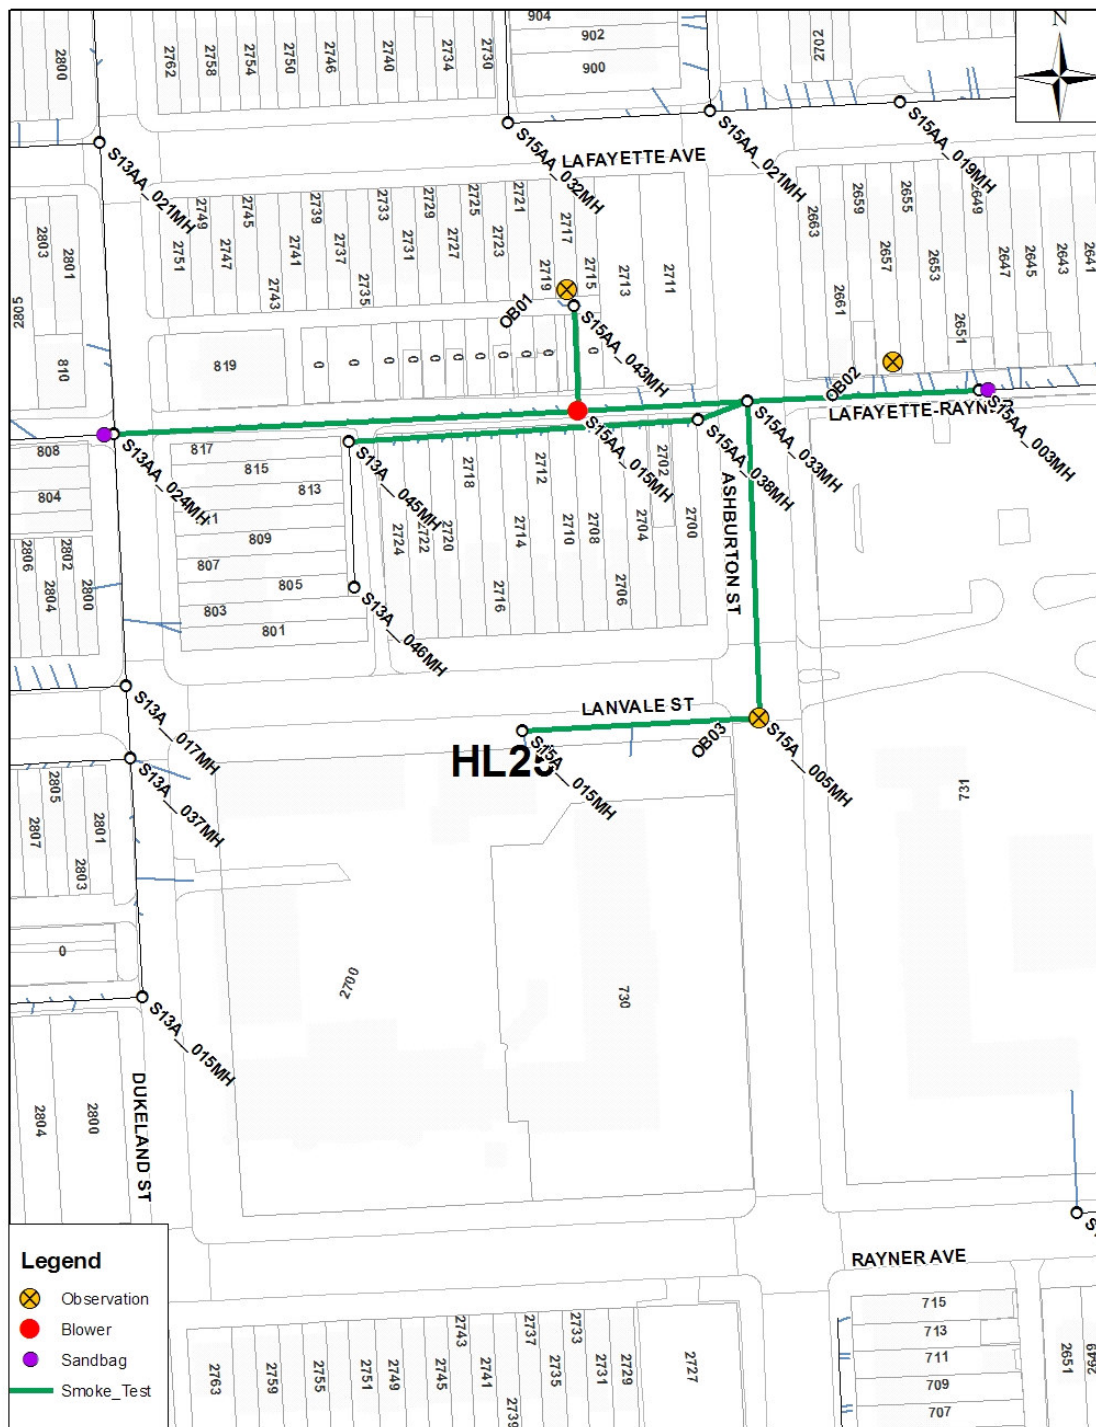

Smoke and Dye Testing Summary

High Level Sewershed

Run Summary

Test ID	Test Type	Date Inspected	Company / Super.	Blower MH	Ground Condition	Notification Made?	Total Length
S1028-186	Smoke	7/21/2009	ADS/TM	S15AA_015MH	Dry	Yes	1,136.67

Isolated Pipes

Pipe ID	Upstream MH	Downstream MH	Length (ft)	Diameter (In)
S15AA_033G1	S15AA_033MH	S15AA_003MH	136.988	8
S15AA_015G1	S15AA_015MH	S15AA_033MH	99.893	8
S13AA_024G1	S13AA_024MH	S15AA_015MH	273.566	8
S15AA_043G1	S15AA_043MH	S15AA_015MH	62.1439	8
S15AA_038G1	S15AA_038MH	S15AA_033MH	31.0224	8
S13A_045G1	S13A_045MH	S15AA_038MH	206.239	8
S15A_005G1	S15A_005MH	S15AA_033MH	187.258	8
S15A_015G1	S15A_015MH	S15A_005MH	139.563	8

Observations & Photos

Obs_ID S1028-186-OB01
Address 2717 Lafayette Ave
Status Private
Source Cleanout

Location Yard - back

Nearest MH S15AA_043MH

Comments Smoke from above-grade cleanout (vented cap) in back yard. 2717 Lafayette Ave.



Picture \S1028-186-OB01-P01.jpg

Comments Back yard, 2717 Lafayette Ave.

Obs_ID S1028-186-OB01
Address 2717 Lafayette Ave
Status Private
Source Cleanout

Location Yard - back

Nearest MH S15AA_043MH

Comments Smoke from above-grade cleanout (vented cap) in back yard. 2717 Lafayette Ave.



Picture \S1028-186-OB01-P02.jpg

Comments Back of house (location view), 2717 Lafayette Ave.

Smoke and Dye Testing Summary

High Level Sewershed

Run Summary

Test ID	Test Type	Date Inspected	Company / Super.	Blower MH	Ground Condition	Notification Made?	Total Length
S1028-186	Smoke	7/21/2009	ADS/TM	S15AA_015MH	Dry	Yes	1,136.67

Obs_ID S1028-186-OB02

Address 2657 Lafayette Ave

Status Private

Source Cleanout

Location Yard - back

Nearest MH S15AA_003MH

Comments Smoke from above-grade cleanout (broken cap) in back yard. 2657 Lafayette Ave.



Picture \S1028-186-OB02-P01.jpg

Comments Back of house (location view), 2657 Lafayette Ave.

Obs_ID S1028-186-OB03

Address Lanvale St. & Ashburton St.

Status Public

Source Other

Location Paved asphalt

Nearest MH S15A_005MH

Comments Smoke from sanitary manhole S15A_005MH with vented storm drain cover.



Picture \S1028-186-OB03-P01.jpg

Comments Lanvale St. & Ashburton St.

Obs_ID S1028-186-OB02

Address 2657 Lafayette Ave

Status Private

Source Cleanout

Location Yard - back

Nearest MH S15AA_003MH

Comments Smoke from above-grade cleanout (broken cap) in back yard. 2657 Lafayette Ave.



Picture \S1028-186-OB02-P02.jpg

Comments Back yard, 2657 Lafayette Ave.

Obs_ID S1028-186-OB03

Address Lanvale St. & Ashburton St.

Status Public

Source Other

Location Paved asphalt

Nearest MH S15A_005MH

Comments Smoke from sanitary manhole S15A_005MH with vented storm drain cover.



Picture \S1028-186-OB03-P02.jpg

Comments Lanvale St. & Ashburton St. (location view) looking west